



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D205-634-041
Job Sheet 195501



Part No: D205-634-041

Job Qty: 1 pcs

Part Name: Replacement Skidtube with Standard Wearplates Fits LH or RH



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 5/24/19

Job Tracking No:

Due Date: 6/5/19

Created By: Marie Lajeunesse

Type: SOLD

Description:

Note: DWG D2580 REV H SHEETS 1,2,3,8 IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ IPP Rev P 10.02.19 per PAR09-043 EC verified by:DD IPP Rev. O 06.02.28 Added paperwork EC IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q 10.12.01 as per chg003 DD ver:EC IPP REV:R 12.01.23 AS PER ECN11-684 VERF:EC IPP REV:S 17.12.08 REMOVE GASKET AS PER INTUITIVE INFO DD VERF:JFS

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
110	Skidtubes - Bend - 1	1 pcs		6/5/19	0.00	0.65	Skidtubes - Bend		MhG
120	Skidtubes - 2 - B4B	1 pcs		6/5/19	0.00	2.89	Skidtubes - 1 - B4B		
							Skidtubes - 2 - B4B		
							Skidtubes - 3 - B4B		MhG
							Skidtubes - 4 - B4B		
							Skidtubes - 5 - B4B		
							Skidtubes - 6 - B4B		
							Skidtubes - 7 - B4B		
130	QC 5	1 pcs		6/5/19	0.00	0.00	QC 5 - 10		
							QC 5 - 12		
							QC 5 - 17		
							QC 5 - 18		BE
							QC 5 - 19		
							QC 5 - 22		
							QC 5 - 24		
							QC 5 - 3		
							QC 5 - 43		
							QC 5 - 49		
							QC 5 - 51		
							QC 5 - 58		
							QC 5 - 68		
							QC 5 - 9		
							QC 5 - 50		
							QC 5 - 30		
							QC 5 - 40		
140	Skidtubes - 3 - B4B	1 pcs		6/5/19	0.00	2.89	Skidtubes - 1 - B4B		
							Skidtubes - 2 - B4B		



Container No: S184938



Part: D205-634-041

Job No: 195501

Serial No/Batch: S184938

Revision: H

Inspector:

Exp Date:

Instructions: TC STC SH96-88 Issue 2, FAA-STD SR005631

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Plex 5/24/19 8:40 AM Dart.lajeunesse.marie

S184938

150 QC 10	1 pcs	6/5/19	0.00 0.00	Skidtubes - 3 - B4B	
				Skidtubes - 4 - B4B	
				Skidtubes - 5 - B4B	<i>BL</i>
				Skidtubes - 6 - B4B	
				Skidtubes - 7 - B4B	
				QC 10 - 10	
160 QC 5	1 pcs	6/5/19	0.00 0.00	QC 10 - 18	
				QC 10 - 24	DAS
				QC 10 - 43	24 MAY 31 2019
				QC 10 - 50	9-89
				QC 10 - 58	
				QC 10 - 9	
170 Handfinish - 1-1 Chemical- B4B	1 pcs	6/5/19	0.00 1.31	QC 5 - 10	
				QC 5 - 12	
				QC 5 - 17	
				QC 5 - 18	
				QC 5 - 19	
				QC 5 - 22	
				QC 5 - 24	DAS
				QC 5 - 3	24 MAY 31 2019
				QC 5 - 43	9-89
				QC 5 - 49	
				QC 5 - 51	
				QC 5 - 58	
				QC 5 - 68	
				QC 5 - 9	
				QC 5 - 50	
				QC 5 - 30	
				QC 5 - 40	
				Handfinish - 1 - 1 - B4B	
				Handfinish - 1 - 2 - B4B	
				Handfinish - 1 - 3 - B4B	<i>JUN 04 2019</i>
				Handfinish - 1 - 4 - B4B	
				Handfinish - 1 - 5 - B4B	
				Handfinish - 1 - 6 - B4B	
				Handfinish - 1 - 7 - B4B	
				Handfinish - 1 - 8 - B4B	
				Handfinish - 1 - 9 - B4B	
				Handfinish - 1 - 10 - B4B	
				Handfinish - 1 - 11 - B4B	
				Handfinish - 1 - 12 - B4B	
				Handfinish - 1 - 13 - B4B	
				Handfinish - 1 - 14 - B4B	
				Handfinish - 1 - 15 - B4B	
				Handfinish - 1 - 16 - B4B	
				Handfinish - 1 - 17 - B4B	
				Handfinish - 1 - 18 - B4B	
				Handfinish - 1 - 19 - B4B	
				Handfinish - 1 - 20 - B4B	
				Handfinish - 1 - 21 -	

				B4B	
				Handfinish - 1 - 22 - B4B	
180 Powdercoat - 1 White GI(A)- B4B	1 pcs	6/5/19	0.00 0.34	Powdercoat - 1 - B4B	
				Powdercoat - 2 - B4B	
				Powdercoat - 3 - B4B	
				Powdercoat - 4 - B4B	
				QC 3 - 10	
				QC 3 - 13	
				QC 3 - 15	
				QC 3 - 17	
				QC 3 - 18	
				QC 3 - 2	
				QC 3 - 28	
				QC 3 - 3	
				QC 3 - 30	
				QC 3 - 34	
				QC 3 - 36	
				QC 3 - 41	
				QC 3 - 51	
				QC 3 - 58	
				QC 3 - 59	
				QC 3 - 68	
				QC 3 - 9	
				QC 3 - 40	
				QC 3 - 19	
				QC 3 - 43	
				QC 3 - 24	
200 Handfinish - 4-1-Assembly-B4B	1 pcs	6/5/19	0.00 1.31	Handfinish - 4 - 1 - B4B	
				Handfinish - 4 - 10 - B4B	
				Handfinish - 4 - 11 - B4B	
				Handfinish - 4 - 12 - B4B	
				Handfinish - 4 - 13 - B4B	
				Handfinish - 4 - 14 - B4B	
				Handfinish - 4 - 15 - B4B	
				Handfinish - 4 - 2 - B4B	
				Handfinish - 4 - 3 - B4B	
				Handfinish - 4 - 4 - B4B	
				Handfinish - 4 - 5 - B4B	
				Handfinish - 4 - 6 - B4B	
				Handfinish - 4 - 7 - B4B	
				Handfinish - 4 - 8 - B4B	
				Handfinish - 4 - 9 - B4B	
210 QC 5	1 pcs	6/5/19	0.00 0.00	QC 5 - 10	
				QC 5 - 12	
				QC 5 - 17	
				QC 5 - 18	
				QC 5 - 19	
				QC 5 - 22	
				QC 5 - 24	
				QC 5 - 3	
				QC 5 - 43	
				QC 5 - 49	
				QC 5 - 51	

DAS
15
9-89

				QC 5 - 58	
				QC 5 - 68	
				QC 5 - 9	
				QC 5 - 50	DAS
				QC 5 - 30	40
				QC 5 - 40	9-89
220	Packaging 3-1 - Stock - B4B	1	6/5/19	0.00 0.00	Packaging 3 - 1 - B4B
	pcs				Packaging 3 - 2 - B4B
					Packaging 3 - 3 - B4B
					Packaging 3 - 4 - B4B
					Packaging 3 - 5 - B4B
					Packaging 3 - 6 - B4B
					Packaging 3 - 7 - B4B
					Packaging 3 - 8 - B4B
					Packaging 3 - 9 - B4B
					Packaging 3 - 10 - B4B
					Packaging 3 - 11 - B4B
					Packaging 3 - 12 - B4B
					Packaging 3 - 13 - B4B
					Packaging 3 - 14 - B4B
					Packaging 3 - 15 - B4B
					Packaging 3 - 16 - B4B
					Packaging 3 - 17 - B4B
					Packaging 3 - 18 - B4B
					Packaging 3 - 19 - B4B
					Packaging 3 - 20 - B4B
					Packaging 3 - 21 - B4B
					Packaging 3 - 22 - B4B
					Packaging 3 - 23 - B4B
					Packaging 3 - 24 - B4B
					Packaging 3 - 25 - B4B
					Packaging 3 - 26 - B4B
					Packaging 3 - 27 - B4B
					Packaging 3 - 28 - B4B
					Packaging 3 - 29 - B4B
					Packaging 3 - 30 - B4B
					Packaging 3 - 31 - B4B
					Packaging 3 - 32 - B4B
					Packaging 3 - 33 - B4B
					Packaging 3 - 34 - B4B
					Packaging 3 - 35 - B4B
					Packaging 3 - 36 - B4B
225	DC - 1 - B4B	1	6/5/19	0.00 0.00	DC - 1 - B4B
	pcs				DC - 2 - B4B
230	QC 21 - FG	1	6/5/19	0.00 0.00	QC 21 - FG - 21
	pcs				QC 21 - FG - 70
					QC 21 - FG - 53

Part Op 110 - Skid tubes - 1-Bend as per program D2580.C on CNC Bender and Folio 16 2-Cut tubes as per Dwg. D2580 3- scribe
 Descriptions: batch# in aft end of tube

120 - Skid tubes - 1- Deburr ends and remove bending marks 2- Prepare tube for welding as per QSI 004

130 - QC5- Inspect part completeness to step on W/O

140 - Skid tubes 1-Weld step D2576 as per Dwg. D2580 and QSI 004 2-Grind welds on step as per Dwg D2580 3- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x17G to start expansion and finish with 1/2 x 18G to achieve dwg dimension. 4-Drill holes for wearplates using DT 8217 & DT8937, 7.40" from most fwd saddle holes (ref only) Open holes to 19/64", adjust stopper not to hit web. Deburr 5-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Deburr 6-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

150 - QC10- Inspect visual per QSI004- ground welds

160 - QC5- Inspect part completeness to step on W/O

170 - Chemical Conversion Coat per QSI005 4.1 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.

180 - White Gloss(Ref.4.3.5.1) per QSI005 4.3-Alum START TIME:

OVEN TEMPERATURE:

Plex 5/24/19 8:40 AM Dart.lajeunesse.marie

FINISH TIME: _____

190 - QC3- Inspect Part Finish

200 - Assemble as per dwg - 1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates A/R Sikaflex-291 517134 Sikaflex expire date: 14-12-92 Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580 3-Inspect for foreign object per QSI 024 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive A/R Sikaflex-291 _____
Sikaflex expire date: 5124342 5-Wing Walk as per Dwg D2580 and QSI 005 4.4 Batch: 5185147

210 - QC5- Inspect part completeness to step on W/O - Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

220 - Identify and pack for shipping as per PPPD205-634-041 Location: _____ PPP Rev: _____

225 - Document Control - Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG006

230 - QC21- Final Inspection - Work Order Release

Job BOM

010211

Part / Item	Component Name	Quantity	Operation	Container
D2580-1	205 Bent Tube	1 pcs (1 ea)	110-Skidtubes - Bend - 1	5179587
D2576-3	Step (Machining Detail)	1 pcs (1 ea)	140-Skidtubes - 3 - B4B	5177095
D4202-1	Spacer	20 pcs (20 ea)	140-Skidtubes - 3 - B4B	5174382
ALS7-1032-130	Rivnut	50 Ea (50 ea)	200-Handfinish - 4-1-Assembly-B4B	5159769
AN3-5A	Bolt	2 Ea (2 ea)	200-Handfinish - 4-1-Assembly-B4B	5149158-1
AN3C4A	Bolt	50 Ea (50 ea)	200-Handfinish - 4-1-Assembly-B4B	5143675
D2594-1	Plug	16 pcs (16 ea)	200-Handfinish - 4-1-Assembly-B4B	5173699
D2594-3	O-Ring	16 pcs (16 ea)	200-Handfinish - 4-1-Assembly-B4B	5173297
D2855	Cap	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	506609
D3564-11	Wearplate Aft	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	5195053
D3564-13	Wearpad Fwd	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	5182445
D3564-5	Wearplate Center	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	5185270
D3564-9	Wearplate Fwd	1 pcs (1 ea)	200-Handfinish - 4-1-Assembly-B4B	* 5186896
NAS1149C0332R	Washer	50 Ea (50 ea)	200-Handfinish - 4-1-Assembly-B4B	5158078
NAS1149D0332J	Washer	2 Ea (2 ea)	200-Handfinish - 4-1-Assembly-B4B	5178378


Job Allocations

Operation	Component Part	Required	Inventory	Allocated
110-Skidtubes - Bend - 1	D2580-1	1	6	0
140-Skidtubes - 3 - B4B	D2576-3	1	47	0
	D4202-1	20	449	0
200-Handfinish - 4-1-Assembly-B4B	ALS7-1032-130	50	1,064	0
	AN3-5A	2	220	0
	AN3C4A	50	1,277	0
	D2594-1	16	122	0
	D2594-3	16	427	0
	D2855	1	53	0
	D3564-11	1	7	0
	D3564-13	1	14	0
	D3564-5	1	1	0
	D3564-9	1	3	0
	NAS1149C0332R	50	3,772	0
	NAS1149D0332J	2	3,644	0


Part Specifications

Specifications could not be found.


Plex 5/24/19 8:40 AM Dart.lajeunesse.marie

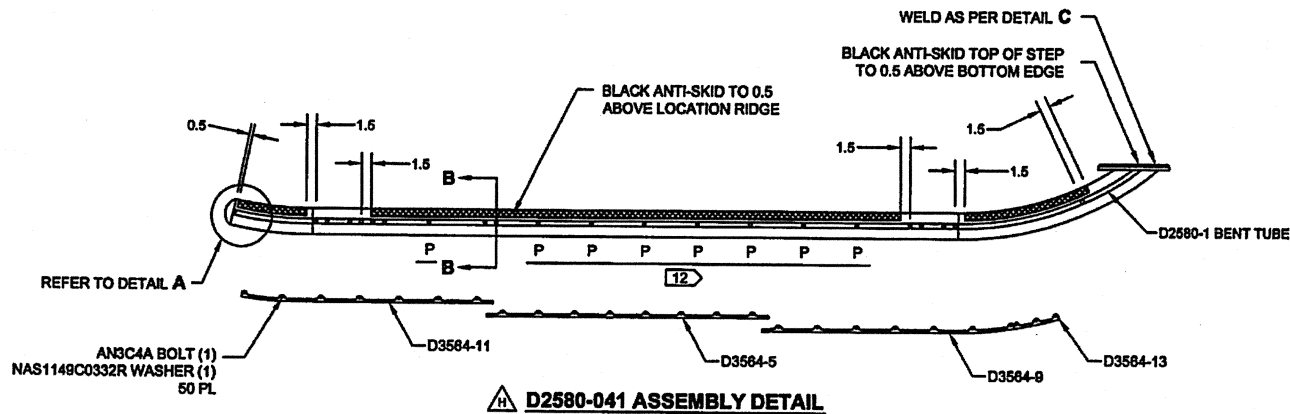

DETAIL A
SCALE 5X

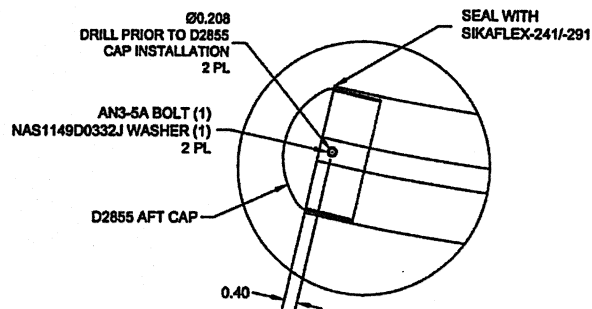


SECTION B-B
SCALE 5X

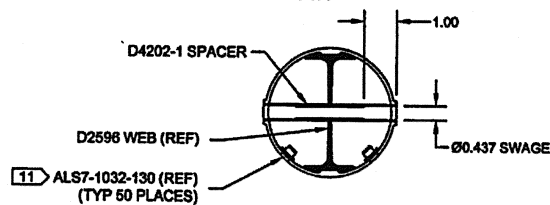

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002


DETAIL C
SCALE 5X

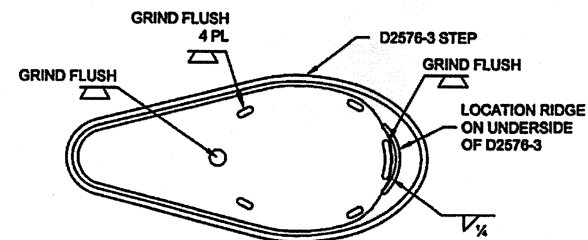

RELEASED

2017 JUL 05


DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 2 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

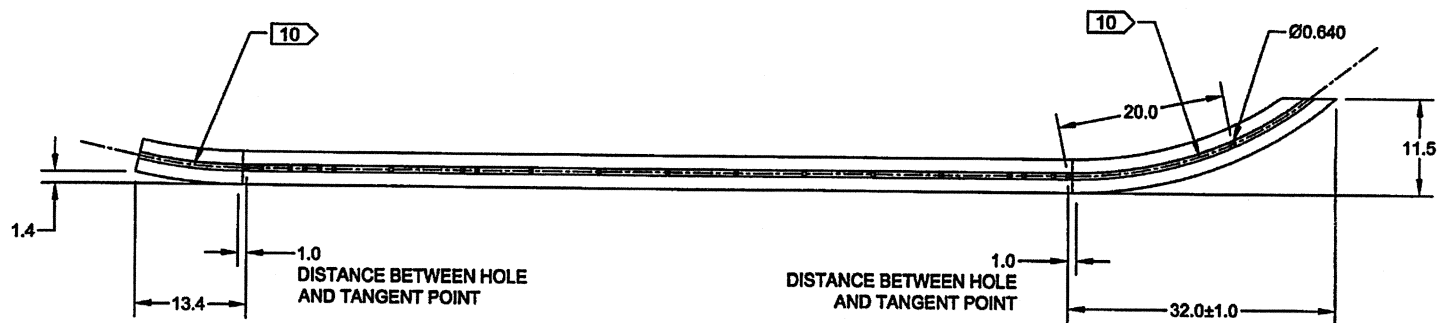

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)


RELEASED
2017 JUL 05 4P

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H SHEET 3 OF 9
MFG. APPR.	<i>[Signature]</i>	TITLE	SCALE
APPROVED	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DE APPR.	<i>[Signature]</i>	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	17.06.09		

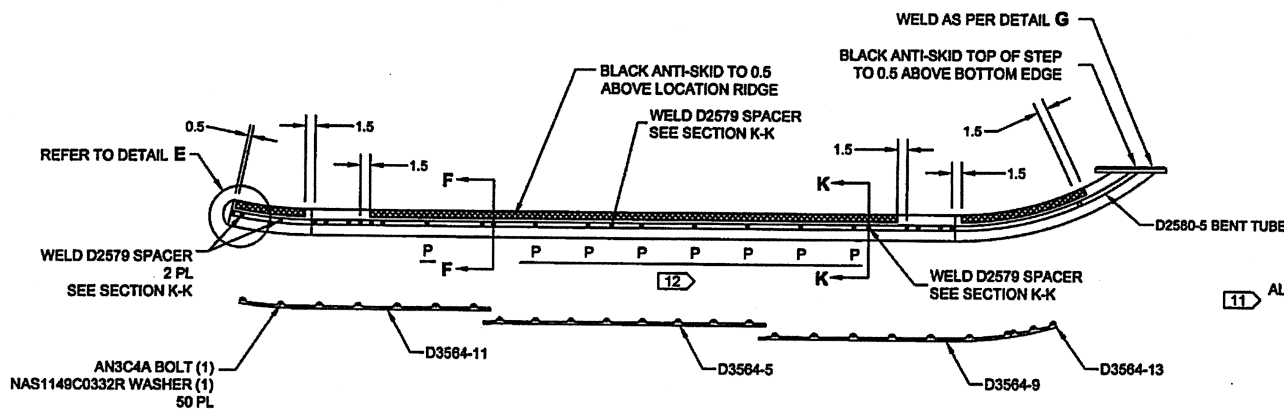


D2580-045 ASSEMBLY DETAIL

SECTION K-K
SCALE 5X

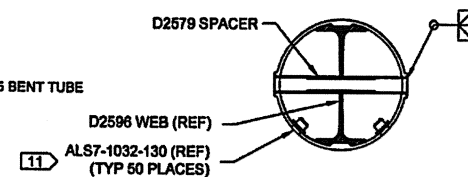


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (4 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. DO NOT C'BORE

DETAIL E
SCALE 5X

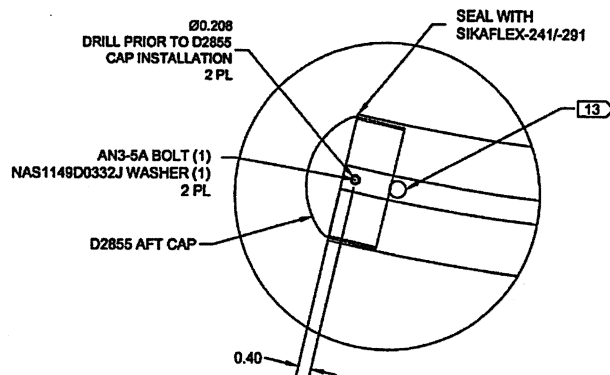


SECTION F-F
SCALE 5X

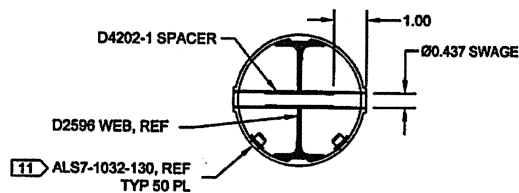


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

DETAIL G
SCALE 5X

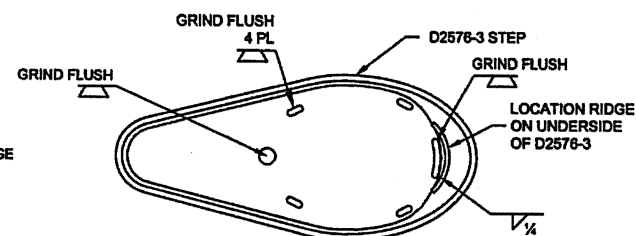

RELEASED
2017 JUL 05




DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 4 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

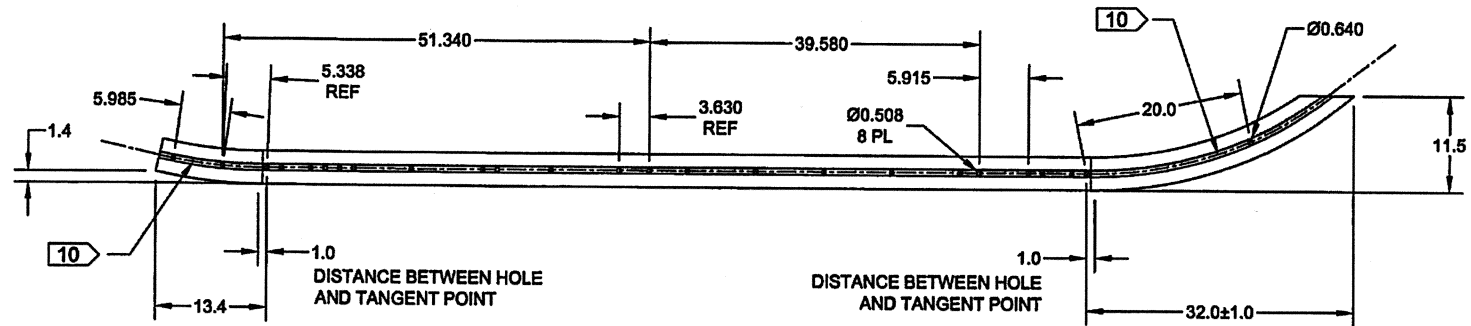


D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

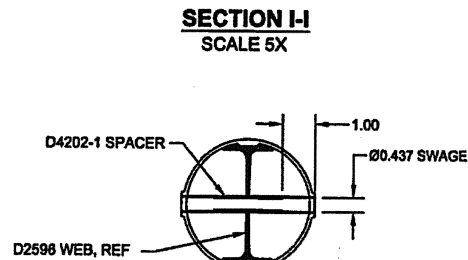
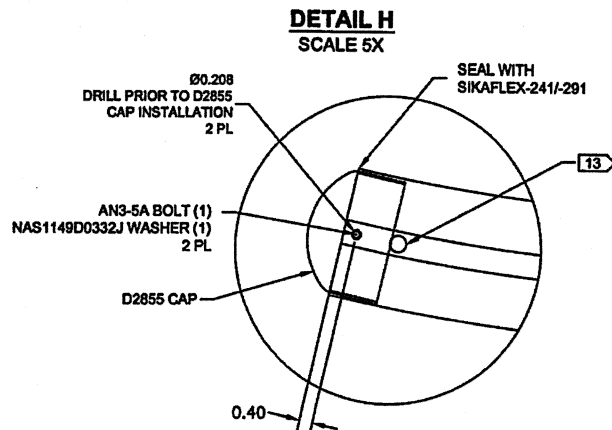
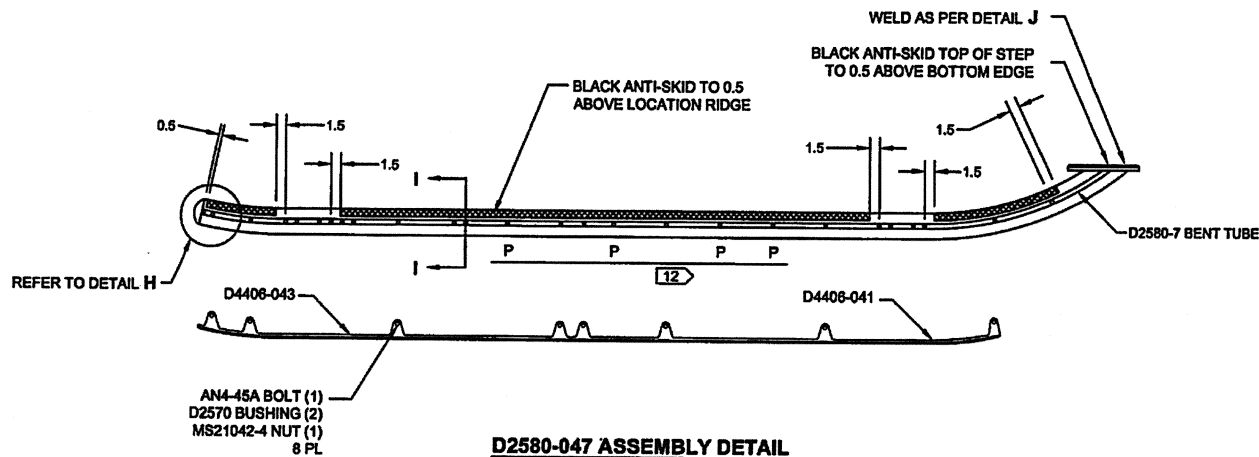


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

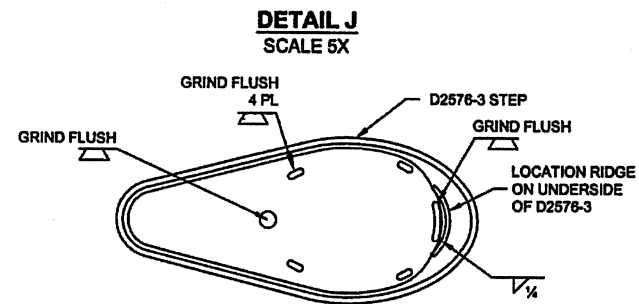


RELEASED
2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 8 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

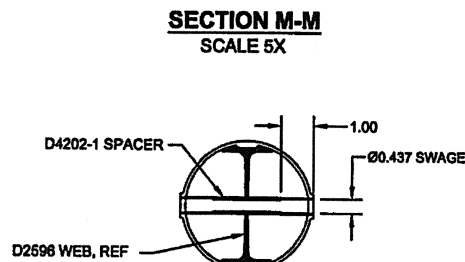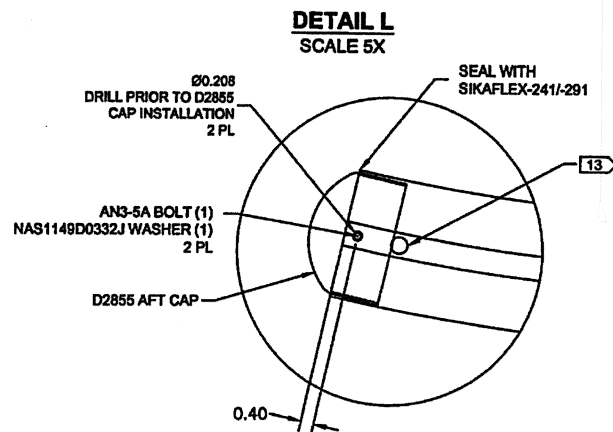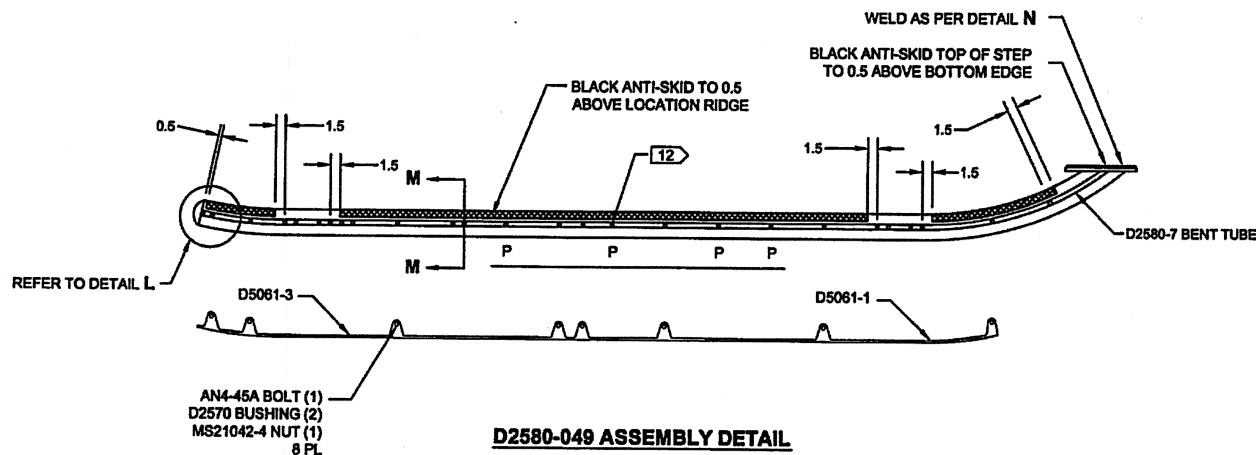


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

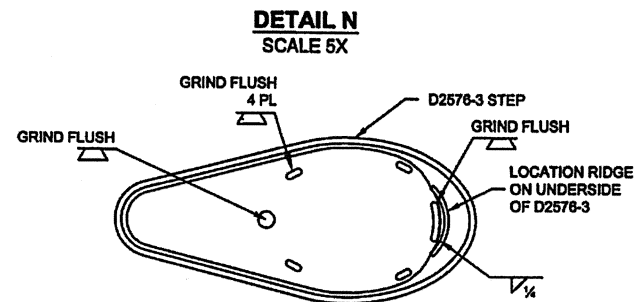

RELEASED

2017 JUL 05


DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 7 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

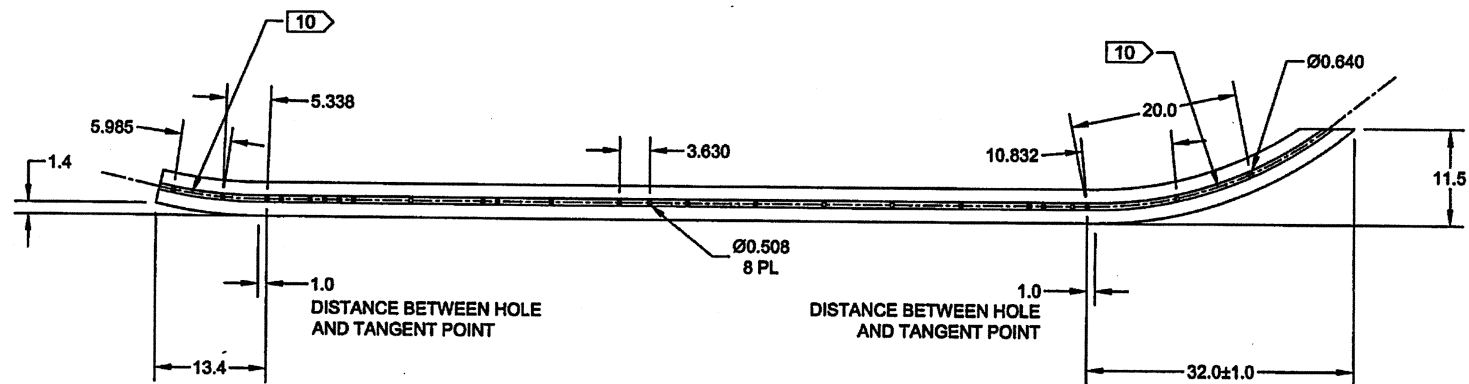


D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H SHEET 8 OF 9
MFG. APPR.	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

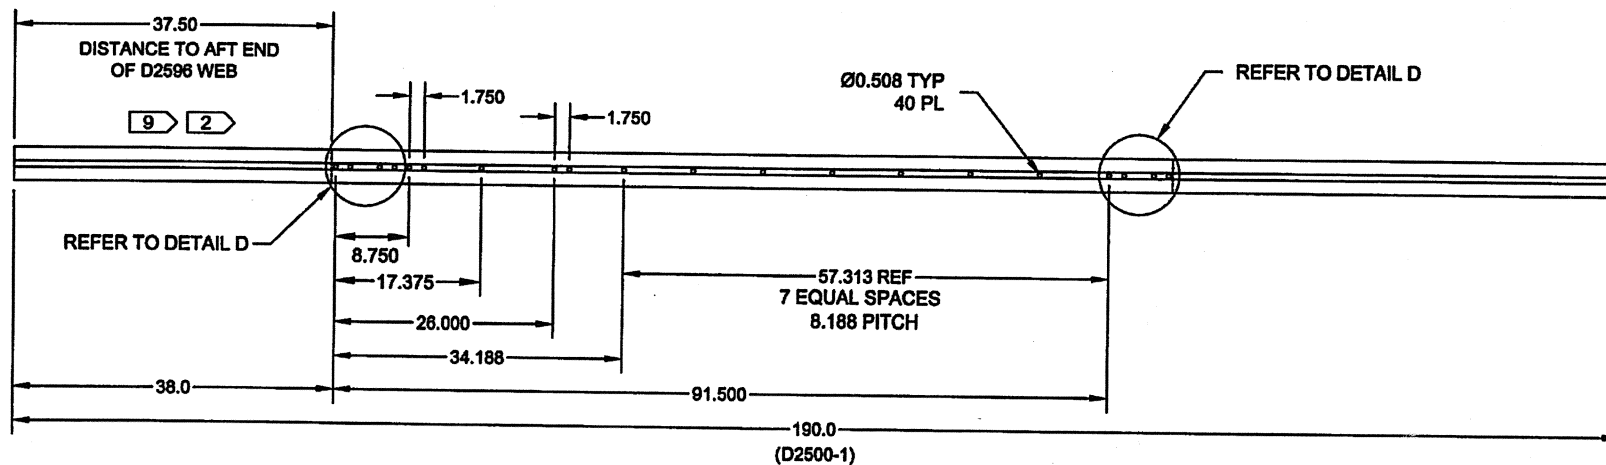

D2580-101 TUBE

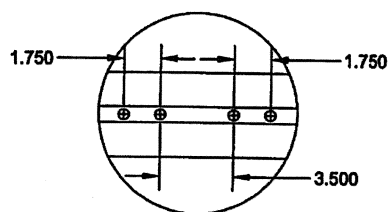

DETAIL D
SCALE 5X

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 9 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8

7

6

5

4

3

2

1

D

C

B

A

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Change Record

PAGE 1 OF 1

Part Number: D205-634-041/-041DG/-041GY

Description: REPLACEMENT SKIDTUBE w/ STANDARD WEARPLATES, LH/RH

[illegible]